

6.3.2 CALIBRATION

Conductivity systems must be calibrated before every water-quality field trip and again at each site before samples are measured. Calibration readings are recorded in the instrument log book and on field forms at the time the instrument is calibrated. Remember, the temperature sensor on the conductivity sensor must be calibrated and District certified within the past 4 months.

Calibration and operating procedures differ, depending on instrument and sensor type.

- ▶ Some conductivity sensors may need to be soaked overnight in deionized water before use—Check the manufacturer's instructions.
- ▶ Some analog instruments require an initial mechanical zero adjustment of the indicator needle.
- ▶ For a cup-type cell, calibration and measurement procedures described for the dip-type cell apply; the only difference is that standards are poured directly into the cup-type cell.
- ▶ When using a dip-type cell, do not let the cell rest on the bottom or sides of the measuring container.

Calibrate at your field site—bring standards to sample temperature.

Conductivity systems normally are calibrated with at least two standards. Calibrate sensors against a standard that approximates sample conductivity and use the second standard as a calibration check. The general procedures described in steps 1–15 below apply to most instruments used for field measurements—check the instrument manual for specific instructions.

1. Inspect the instrument and the conductivity sensor for damage. Check the battery voltage. Make sure that all cables are clean and connected properly.
2. Turn the instrument on and allow sufficient time for electronic stabilization.

3. Select the correct instrument calibration scale for expected conductivity.
4. Select the sensor type and the cell constant that will most accurately measure expected conductivity.
5. Select two conductivity standards that will bracket the expected sample conductivity. Verify that the date on the standards has not expired.
6. Equilibrate the standards and the conductivity sensor to the temperature of the sample.
 - Put bottles of standards in a minnow bucket, cooler, or large water bath that is being filled with ambient water.
 - Allow 15 to 30 minutes for thermal equilibration. Do not allow water to dilute the standard.
7. Rinse the conductivity sensor, the thermometer (liquid-in-glass or thermistor), and a container large enough to hold the dip-type sensor and the thermometer.
 - **First**, rinse the sensor, the thermometer, and the container three times with deionized water.
 - **Next**, rinse the sensor, the thermometer, and the container three times with the standard to be used.
8. Put the sensor and the thermometer into the rinsed container and pour in fresh calibration standard.
9. Measure water temperature. **Accurate conductivity measurements depend on accurate temperature measurements or accurate temperature compensation.**
 - If the sensor contains a calibrated thermistor, use this thermistor to measure water temperature.
 - If using a manual instrument without a temperature display or temperature compensation, adjust the instrument to the temperature of the standard using a calibrated liquid-in-glass or a thermistor thermometer.
10. Agitate a submersible-type conductivity sensor up and down under the solution surface to expel air trapped in the sensor. Read the instrument display. Agitate the sensor up and down under the solution surface again, and read the display. Repeat the procedure until consecutive readings are the same.

11. Record the instrument reading and adjust the instrument to the known standard value.
 - For nontemperature-compensating conductivity instruments, apply a temperature-correction factor to convert the instrument reading to conductivity at 25°C.
 - The correction factor depends to some degree on the specific instrument used—use the temperature-correction factor recommended by the manufacturer. If this is not available, use correction factors from table 6.3–3.
 - If an instrument cannot be adjusted to a known calibration standard value, develop a calibration curve. After temperature compensation, if the percentage difference from the standard exceeds 5 percent, refer to the troubleshooting guide (section 6.3.4).
12. Record in the instrument log book and on field forms:
 - The temperature of the standard solution.
 - The known and the measured conductivity of the standard solution (including \pm variation).
 - The temperature-correction factor (if necessary).
13. Discard the used standard into a waste container. Rinse the sensor, thermometer, and container thoroughly with deionized water.
14. Repeat steps 7 through 13 with the second conductivity standard.
 - The purpose for measuring a second standard is to check instrument calibration over the range of the two standards.
 - The difference from the standard value should not exceed 5 percent.
 - If the difference is greater than 5 percent, repeat the entire calibration procedure. If the second reading still does not come within 5 percent of standard value, refer to the troubleshooting guide in section 6.3.4 or calibrate a backup instrument.
 - **Switching instrument calibration scales could require recalibration.**
15. Record in the instrument log book and on field forms the calibration data for the second standard.

Do not use expired standards.
Never reuse standards.

Table 6.3–3. Correction factors for converting non-temperature-compensated values to conductivity at 25 degrees Celsius, based on 1,000 microsiemens potassium chloride solution

[Use of potassium-based constants on non-potassium-based waters generally does not introduce significant errors for general purpose instruments used to measure conductivity]

Temperature (degrees Celsius)	Correction factor	Temperature (degrees Celsius)	Correction factor	Temperature (degrees Celsius)	Correction factor
0.5	1.87	10.5	1.39	20.5	1.09
1.0	1.84	11.0	1.37	21.0	1.08
1.5	1.81	11.5	1.35	21.5	1.07
2.0	1.78	12.0	1.33	22.0	1.06
2.5	1.76	12.5	1.32	22.5	1.05
3.0	1.73	13.0	1.30	23.0	1.04
3.5	1.70	13.5	1.28	23.5	1.03
4.0	1.68	14.0	1.27	24.0	1.02
4.5	1.66	14.5	1.26	24.5	1.01
5.0	1.63	15.0	1.24	25.0	1.00
5.5	1.60	15.5	1.22	25.5	0.99
6.0	1.58	16.0	1.21	26.0	0.98
6.5	1.56	16.5	1.19	26.5	0.97
7.0	1.54	17.0	1.18	27.0	0.96
7.5	1.52	17.5	1.16	27.5	0.95
8.0	1.49	18.0	1.15	28.0	0.94
8.5	1.47	18.5	1.14	28.5	0.93
9.0	1.45	19.0	1.13	29.0	0.92
9.5	1.43	19.5	1.12	29.5	0.91
10.0	1.41	20.0	1.11	30.0	0.90

To extend the temperature range shown in table 6.3–3, consult the manufacturer's guidelines. If these are unavailable, use the following equation:

$$C_{25} = \frac{C_m}{1 + 0.02 (t_m - 25)}$$

where,

C_{25} = corrected conductivity value adjusted to 25°C;

C_m = actual conductivity measured before correction; and

t_m = water temperature at time of C_m measurement.